

LAND CORNER RECORD

Index: J-14	Corner: W1/16 Corner between Sections 10 and 15	State of Indiana - Hoosier National Forest
Section: 10	Township: 7N Range: 1E P.M.: 2nd	County: Monroe
Coordinate:	Lat./N: 1384749.766 Long./E: 3146529.871	Datum: NAD83 IN West Zone, US Survey Feet


CORNER HISTORY: (Chronological history of corner)

1.) Date of Survey:	Surveyor:	Monument:	Recording Information:	Monument Photograph:
5/17/1983	Ken Anderson L.S. #80040545	A stamped 3" aluminum monument set	USDA Forest Service Bedford, IN	
Reference Objects:	Species:	Diameter:	Bearing:	Distance:
Record evidence of prior survey:				
2.) Date of Survey:	Surveyor:	Monument:	Recording Information:	
Reference Objects:	Species:	Diameter:	Bearing:	Distance:
Record evidence of prior survey:				

ACCESSORIES: Bearing and distance from monument to witness object.

Reference Objects:	Object or Tree Species:	Diameter:	Bearing:	Distance:
	Black Oak* **	21"	N34°W	18.55'
	Pignut Hickory* **	14"	S35°E	18.16'
	Pignut Hickory* **	10"	N86°W	5.69'
	Wood Post	4"X4"	N00°E	2.40'
** = sign and nail only * = old blaze at base of tree				
Monument Found or Set:	An iron pipe with a 3" brass cap stamped "T7N R1E W1/16 S.10 S.15 1981" found 1.0' above grade.			


MONUMENT SKETCH

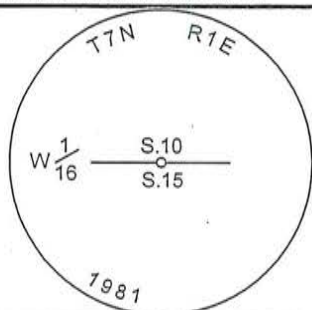

NARRATIVE REFERENCE:

Monument is an iron pipe with a 3" brass cap stamped "T7N R1E W1/16 S.10 S.15 1981" found 1.0' above grade, a carsonite post is located 1.0' west of the monument, located half way down an east facing slope, small north-south running drainage at the toe of slope, +/- 100' east of a gravel road at the top of the hill, surrounded by mature forest, +/- 100' northeast of several large limestone blocks next to the gravel road.

SECTION DIAGRAM

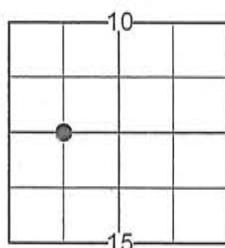

Corner Location = ●

PERPETUATION RECORD:

The record monument was found undisturbed and maintained by remarking three existing bearing trees and establishing one new reference object. Three existing bearing trees were recovered from an unknown source.

Three existing bearing trees were marked with a bearing tree sign and mag nail.

Referenced on BRCJ survey recorded as InstNo.2018011507

Accepted by the Monroe County Surveyor Review Board on August 6, 2019.

Section: 10 T7N R1E

Prepared By: BRCJ

(Project#3-0823)

Date: 5/2018